

	GROUP BOD	MODEL 2016MY Sorento (UMa)
	NUMBER 114 (REV 1, 09/30/2015)	DATE September 2015
TECHNICAL SERVICE BULLETIN		
SUBJECT: SERVICE ACTION: SUNVISOR INSPECTION/REPLACEMENT (SA197)		

★ NOTICE

This bulletin has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.

This bulletin provides the procedure to modify or, if necessary, replace the sun visors on some 2016MY Sorento (UMa) vehicles, produced from Job #1 through March 12, 2015 which may experience an inoperative, or constantly ON vanity lamp. This concern may be caused by a short to ground condition at the sun visor pivot. Follow the procedure in this bulletin to apply a preventive modification to the harness, or to replace the affected sun visor. To prevent and/or correct this condition, Kia is requesting the completion of this Service Action on all affected vehicles, including dealer stock, prior to delivery. Before conducting the procedure, verify the vehicle is included in the list of affected VINs.



★ NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on WebDCS (Service> Warranty Coverage> Warranty Coverage Inquiry> Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs> Not Completed Recall> Recall VIN> Select Report), which includes a list of affected vehicles.

This issue number is SA197.

File Under: <Body>

Circulate To: ☒ General Manager ☒ Service Manager ☒ Parts Manager

☒ Service Advisor(s) ☒ Technician(s) ☒ Body Shop Manager ☐ Fleet Repair

SUBJECT: SERVICE ACTION: SUNVISOR INSPECTION/REPLACEMENT (SA197)

Service Procedure:

1. Use a clean, non-marring plastic trim removal tool to detach the sunvisor trim cover.




CAUTION


- Be sure to wear disposable gloves throughout this procedure to avoid soiling the headliner or sunvisor.
- Use a non-marring trim removal tool (such as Snap-on® P/N PBN5 or equivalent) to avoid damaging trim pieces.



2. Remove two (2) screws securing the sunvisor in place.

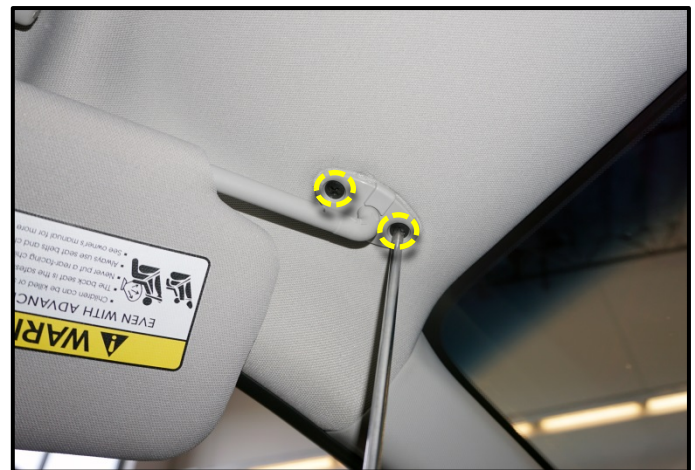


3. Gently pull the sunvisor harness through the access hole in the headliner and partially remove the fabric tape from around the connector.

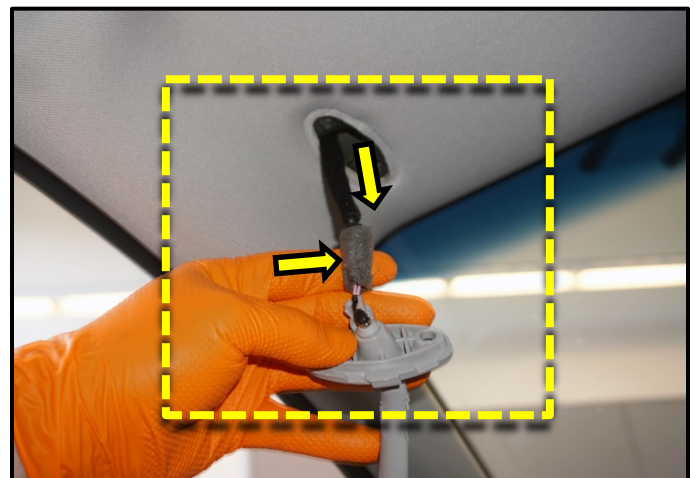


SUBJECT: SERVICE ACTION: SUNVISOR INSPECTION/REPLACEMENT (SA197)

4. Use a pick tool to release the connection between the sunvisor and the rest of the harness.

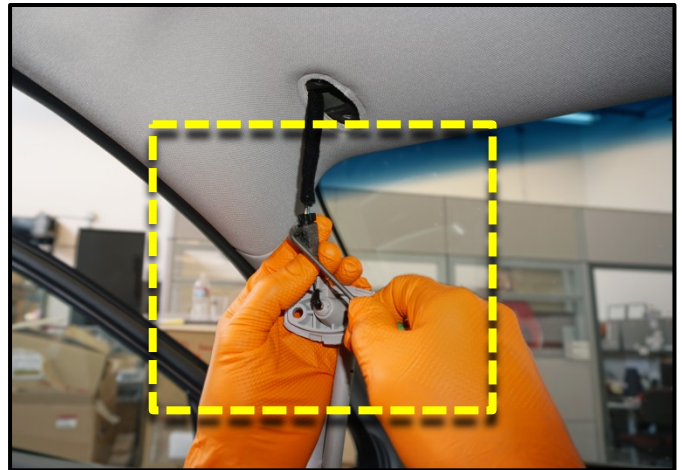

5. Place the sunvisor on a clean work surface, remove the harness from the holder and inspect it for exposed wiring. If the harness shows no visible signs of damage, proceed to step 6. If the harness shows visible signs of damage, proceed to step 7.

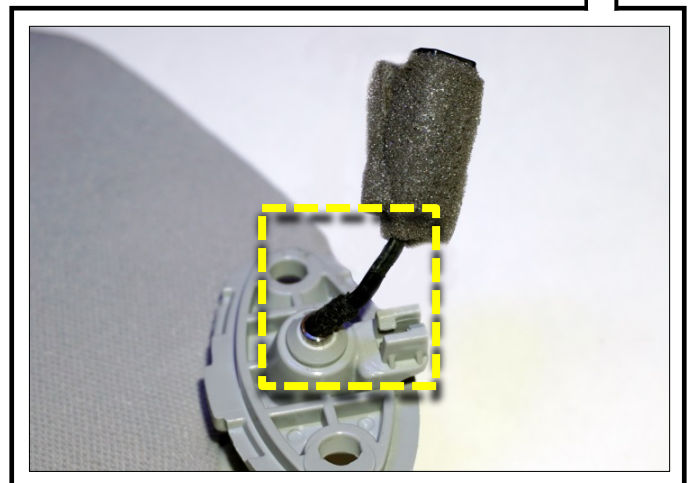


SUBJECT: SERVICE ACTION: SUNVISOR INSPECTION/REPLACEMENT (SA197)

6. If the harness is NOT damaged, wrap the harness with fabric tape, to prevent future damage.


NOTE: Specific fabric tape was provided to your parts department (Part# UM150 SATAPE)

★ NOTICE


When re-installing the sunvisor, do NOT re-insert the harness into the wire holder.

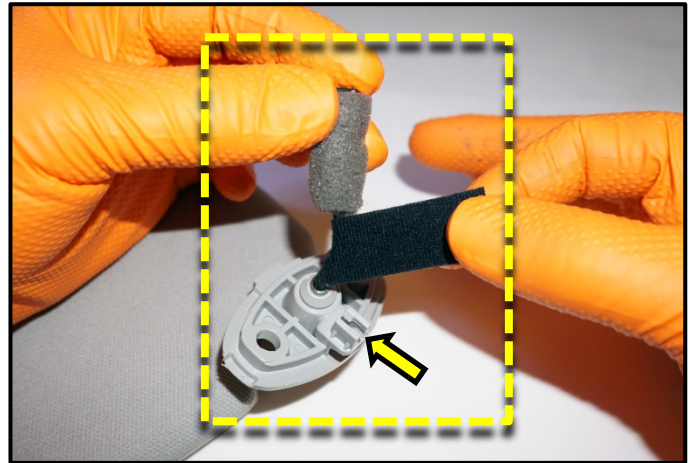

7. If the harness shows evidence of damage, replace the affected sunvisor with a replacement part.

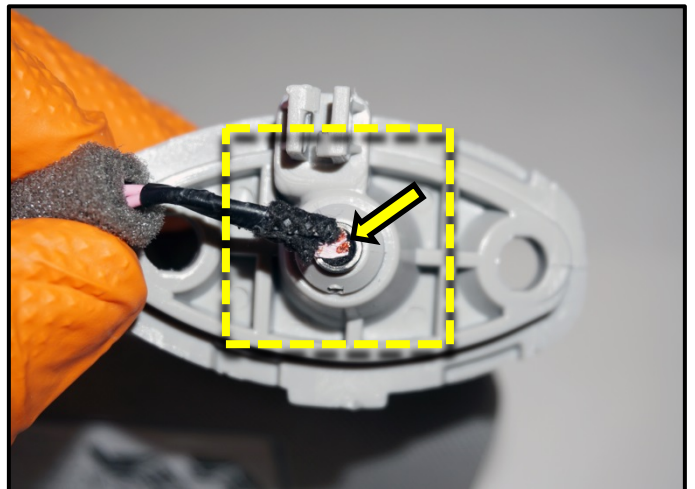

8. Prior to installing the replacement sunvisor, ensure the harness is NOT installed in the wire holder.

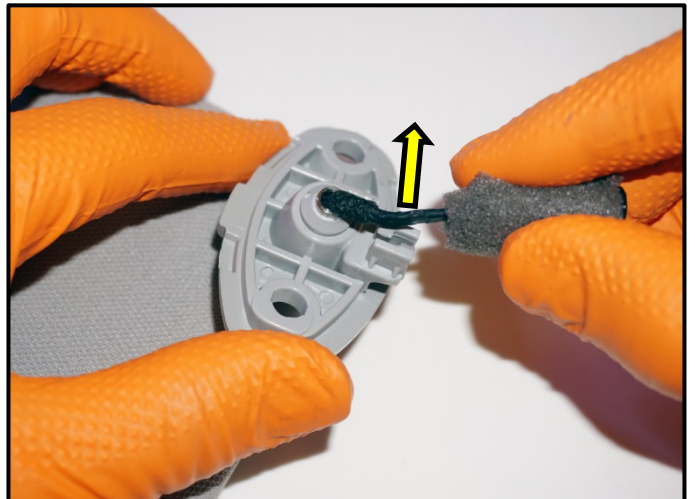

SUBJECT: SERVICE ACTION: SUNVISOR INSPECTION/REPLACEMENT (SA197)

REQUIRED PARTS:

Refer to EPC for applicable part number information by trim color.

REQUIRED TOOLS:

Part Name	Part Number	Qty.	Figure	Comments
Fabric Tape	UM150 SATAPE	2		Two (2) rolls of fabric tape were shipped to each dealer's parts department. For additional supplies, open a Techline case.

AFFECTED VEHICLE PRODUCTION RANGE:

Model	Production Date Range
Sorento (UMa)	Job #1 through March 12, 2015

WARRANTY CLAIM INFORMATION:

Claim Type	Causal P/N	Qty.	N Code	C Code	Repair Description	Labor Op Code	Time	Related Parts	Qty.
V	85235 A9000BGA	0	N99	C99	(SA197) Sunvisor Repair	150A12R0	0.3 M/H	N/A	0
					(SA197) Sunvisor Replace One (1)/ Repair One (1)	150A12R1	0.3 M/H	85210C6010BGA	1
								85210C6010BHH	
								85210C6510BGA	
								85210C6510BHH	
								85210C6710WK	
								85220C6010BGA	
								85220C6010BHH	
								85220C6510BGA	
								85220C6510BHH	
								85220C6710WK	
					(SA197) Sunvisor Replace Two (2)	150A12R2	0.4 M/H	85210C6010BGA	2
								85210C6010BHH	
								85210C6510BGA	
								85210C6510BHH	
								85210C6710WK	
								85220C6010BGA	
								85220C6010BHH	
								85220C6510BGA	
								85220C6510BHH	
								85220C6710WK	

NOTE: Only one op code can claimed per repair

★ NOTICE

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SA197 when accessing the WebDCS system.